
	ALBAU LTD	V 03
	Product technical data sheet	v1
		Page 1
		Pages 2

## WTO AB(02) / Two-sided wind window outside tape with butyl and acrylic stripe

Vapour permeable membrane TOU Outside is dedicated to seal joints between the jams and the door or window frames from the external side of the partition. By the use of high quality permeable membrane this tape is able to shed the vapour from the joint into outside.

### Product advantages:

- Easy installation;
- Easy to plastering, painting;
- Strong glue ribbon allows efficient and fast installation, even in working gloves;
- Resistant to rainfall;
- Wind-tightness;
- Fulfills a requirements of high class energy saving;

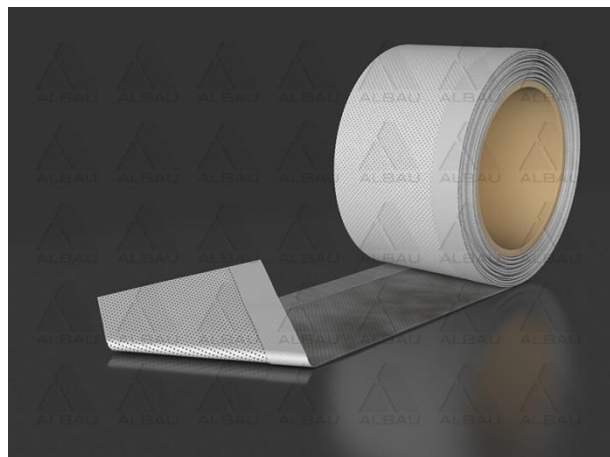

Product code	EAN	Width (mm)	Roll length (m)	Color
ALB-WTO-AB(02)-075-25	4751023403144	75	25	White
ALB-WTO-AB(02)-100-25	4751023403144	100	25	White

### Construction of window sealing tapes:

Window sealing tapes are laminates made from two polypropylene non-woven combined with special membrane in the middle. It guarantees a proper amount of Sd coefficient. Sd coefficient determines how thick a layer of air must be, to put the same resistance to vapor as a membrane. The lower amount of Sd coefficient, the higher vapor-tightness of the membrane.

Product has a special acrylic glue ribbon, allowing installation to door or window frame, also in unfavorable weather. It could be also equipped with butyl glue ribbon, what allows it to stick to the wall. It eliminates necessity of using assembly glue. In our products we are using high quality acrylic and butyl butyl glue.

Our window sealing tapes are compatible with glues, plasters, paints etc. It could be used in places, where is necessity of using high vapor-tightness products.



### MADE IN EUROPE


Distributor: Ltd "Albau" – Ritvari, Rumbula, Stopinu district, LV-2121, Latvia, Reg.No. – 40103561205



[www.albau.eu](http://www.albau.eu)



[www.xbau.eu](http://www.xbau.eu)

	ALBAU LTD	<b>V 03</b>
	<b>Product technical data sheet</b>	v1
		Page 2
		Pages 2

**Assembly instruction:**

**1. Preparing the surface:**

Window hole should be prepared properly. First of all, window or door hole must be cleaned and primed all over the surface. In case, when wall is rugged, it should be equalized with cement mortar in order to ensure proper glue adhesion.

**2. Preparing the window:**

Before sticking tapes to window, frame should be degrease. Frame must be dry and clean. Next step is to fit on the window in order to check distances between window and hole corners and proper tapes selection.

**3. Sticking tapes to the window:**

Window sealing tapec setup should be made in this sequence:

- 1) Lower window area
- 2) Sides of window areas
- 3) Upper window area

Vapor-tight tape (blue) should be sticked to inner side of frame, while vapor-permeable tape (grey) to outer side. After that its possible to install yhe window, stick outside tape to the wall and fill the gap with polyurethane foam. After removing ekscess of polyurethane foam, stick inside tape to the wall.

In case of easy Access to window its possible to stick tapes after installing window.

**4. Installing the window:**

Window installation should be done according to producent reccomendation.

Properties	Unit	Parameter	Testing method
Breaking load:	MPa		PN-EN 12311-2 : 2010 Method B
- longitudinal		≥ 7,0	
- lateral		≥ 3,0	
Breaking load at rapture :	%		PN-EN 12311-2 : 2010 Method B
- longitudinal		≥ 10	
- lateral		≥ 25	
Diffusion resistance regarding to the air layer thickness Sd, m		≤ 0.06	PN-EN ISO 12572:2004
-			
Adhesion to :	N / 25 mm		PN-EN 1939 : 2007
- wood		≥ 3,5	
- PVC		≥ 2,5	
Butyl rubber adhesion to :	N / 25 mm		PN-EN 1939 : 2007
- autoclaved aerated concrete		≥ 25	
- ceramics, silicates		≥ 40	



**MADE IN EUROPE**

Distributor: Ltd "Albau" – Ritvari, Rumbula, Stopinu district, LV-2121, Latvia, Reg.No. – 40103561205



[www.albau.eu](http://www.albau.eu)



[www.xbau.eu](http://www.xbau.eu)